

UPDATE REPORT -- PREVIOUS REPORT DATE September 19, 1983

NRC FORM 368 (7-77)

*Update on failed SPC surge tank level transmitter*

U. S. NUCLEAR REGULATORY COMMISSION

363

LICENSEE EVENT REPORT

NOV 16 1984

BFW

CONTROL BLOCK: 191514114 ①

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

01 | P | A | T | M | I | 2 | 2 | 0 | 0 | - | 0 | 0 | 0 | 0 | 0 | - | 0 | 0 | 3 | 4 | 1 | 1 | 1 | 1 | 4 | 5  
7 8 9 14 15 25 26 57 58

CON'T  
01 | REPORT SOURCE | L | 6 | 0 | 5 | 0 | 0 | 0 | 3 | 2 | 0 | 7 | 0 | 8 | 1 | 8 | 8 | 3 | 8 | 1 | 0 | 1 | 2 | 8 | 4 | 9  
7 8 60 61 68 69 74 75 80

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES ⑩

02 | While the Standby Pressure Control (SPC) was isolated from the Reactor Coolant  
03 | System, SPC Surge Tank Level Transmitter SPC-LT-3A failed low. Without SPC-LT-3A,  
04 | surveillance requirements of Tech Spec Section 4.1.1.1(i) cannot be performed. The  
05 | tank level transmitter was temporarily repaired, returned to service, and the  
06 | required surveillance resumed. No significant occurrence resulted from this  
07 | event.

08 | \_\_\_\_\_ 80

09 | SYSTEM CODE | C | J | 11 | CAUSE CODE | E | 12 | CAUSE SUBCODE | E | 13 | COMPONENT CODE | I | N | S | T | R | U | 14 | COMP. SUBCODE | T | 15 | VALVE SUBCODE | Z | 16 |  
7 8 9 10 11 12 13 18 19 20

17 | LER/RO REPORT NUMBER | 8 | 3 | EVENT YEAR | 8 | 3 | SEQUENTIAL REPORT NO. | 0 | 4 | 0 | OCCURRENCE CODE | 0 | 3 | REPORT TYPE | X | REVISION NO. | 1 |  
21 22 23 24 26 27 28 29 30 31 32

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS ⑰

10 | A loose resistor on the terminal block of SPC-LT-3A interrupted the current loop of  
11 | the Level Transmitter causing level indication to fail low. The block was  
12 | jumpered, restoring level indication without local indication. The resistor terminal  
13 | block was replaced and Surveillance Procedure 4301-S1 was revised to allow use of a  
14 | backup transmitter.

15 | FACILITY STATUS | X | 28 | POWER | 0 | 0 | 0 | 29 | OTHER STATUS | Recovery Mode | 30 | METHOD OF DISCOVERY | A | 31 | DISCOVERY DESCRIPTION | Operator observation | 32 |  
7 8 9 10 12 13 44 45 46 80

16 | ACTIVITY CONTENT | Z | 33 | Z | 34 | AMOUNT OF ACTIVITY | N/A | 35 | LOCATION OF RELEASE | N/A | 36 |  
7 8 9 10 11 44 45 80

17 | PERSONNEL EXPOSURES NUMBER | 0 | 0 | 0 | 37 | TYPE | Z | 38 | DESCRIPTION | N/A | 39 |  
7 8 9 11 12 13 80

18 | PERSONNEL INJURIES NUMBER | 0 | 0 | 0 | 40 | DESCRIPTION | N/A | 41 |  
7 8 9 11 12 80

19 | LOSS OF OR DAMAGE TO FACILITY TYPE | Z | 42 | DESCRIPTION | N/A | 43 |  
7 8 9 10 80

20 | PUBLICITY ISSUED DESCRIPTION | N | 44 | DESCRIPTION | N/A | 45 |  
7 8 9 10 80

NAME OF PREPARER Russ Wells PHONE (717) 948-8461

10-21-85  
Wells

Rev. 0  
on file

8410230137 841012  
PDR ADCK 05000320  
S PDR

NRC USE ONLY

LER 83-040/03X-1  
EVENT DATE - August 18, 1983

I. EXPLANATION OF THE OCCURRENCE

On August 18, 1983, the Standby Pressure Control (SPC) System was isolated from the Reactor Coolant System (RCS) while the RCS level was lowered for recovery operations. On August 18, 1983, at 0755 hours, it was discovered that the SPC Surge Tank Level Instrumentation (SPC-LT-3A) failed low. Operation of SPC-LT-3A is required in order to perform the surveillances called for in Recovery Operations Plan Section 4.1.1.1(i)1. This placed the unit into the Action Statement of Technical Specification 3.1.1.1. Subsequently, the level instrumentation was repaired and returned to service at 1435 hours on August 19, 1983, the required surveillance was resumed, and the Action Statement to restore the system to operable status within 72 hours was satisfied. This condition is considered thirty (30) day reportable under Technical Specification 6.9.1.9(b).

This event had similar aspects to LER's 83-29, 83-02, 82-37, 82-34, 82-22, and 82-21.

II. CAUSE OF THE OCCURRENCE

Maintenance investigations discovered a loose resistor on the terminal block of the SPC-LT-3A terminal box.

III. CIRCUMSTANCES SURROUNDING THE OCCURRENCE

At the time of the occurrence, the Unit 2 facility was in a long-term cold shutdown state. The reactor decay heat was being removed via loss to ambient. Throughout the event there was no effect on the Reactor Coolant System or the core.

IV. CORRECTIVE ACTIONS TAKEN OR TO BE TAKEN

Immediate: The terminal block containing the resistor was jumpered which returned the transmitter loop to operation without local level indication.

Long-Term: The terminal block containing the resistor was replaced on October 20, 1983. Surveillance Procedure 4301-S1, "Shift and Daily Checks", was revised on October 10, 1983, to permit the use of SPC-LT-3B for Surge Tank Level monitoring.

V. COMPONENT FAILURE DATA

The SPC Surge Tank Level Transmitter, SPC-LT-3A, is a Foxboro Model E 13DM Transmitter. This transmitter's terminal block containing the resistor is Part No. N0151KF.



**GPU Nuclear Corporation**  
Post Office Box 480  
Route 441 South  
Middletown, Pennsylvania 17057-0191  
717 944-7621  
TELEX 84-2386  
Writer's Direct Dial Number:

(717) 948-8461

4410-84-L-0045  
Document ID 0017A

October 12, 1984

US Nuclear Regulatory Commission  
Document Control Desk  
Washington, DC 20555

Dear Sir:

Three Mile Island Nuclear Station, Unit 2 (TMI-2)  
Operating License No. DPR-73  
Docket No. 50-320  
Updated Licensee Event Reports

The Licensee Event Reports listed in Attachment 1 have been updated and are enclosed as Attachment 2 to this letter.

If you have any questions concerning this information, please contact Mr. J. J. Byrne of my staff.

Sincerely,

F. R. Standerfer  
Vice President/Director, TMI-2

FRS/RDW/jep

Attachments

cc: Regional Administrator - Office of I & E, Dr. T. E. Murley  
Program Director - TMI Program Office, Dr. B. J. Snyder  
Deputy Program Director - TMI Program Office, Mr. L. H. Barrett

8410230034 841012  
PDR ADOCK 05000320  
S PDR

GPU Nuclear Corporation is a subsidiary of the General Public Utilities Corporation

IE 22  
1/1

LER UPDATE PACKAGE

82-038/03L-1  
83-007/03X-1  
83-020/03X-1  
83-021/03X-1  
83-022/03X-1  
83-023/01X-1  
83-024/01X-1  
83-025/03X-1  
83-031/03X-1  
83-036/03X-2  
83-040/03X-1  
83-042/01X-1  
83-043/03X-1  
83-044/03X-1  
83-046/03X-1  
83-050/01X-1  
83-051/03X-1  
83-052/03X-1  
83-055/03X-1